Ship Name: PS DREAM Recognized Org: Bureau Veritas

Ship Type: Chemical Tankship Recognized Security Organization (RSO):

Flag: Panama

Recognized Org (RO) Related: **Not Class Related** IMO Number: 9358307

Date of Action: 3/14/2023 Relevant Certificates:

Action Taken: **Detention**

Organization Related Port: Corpus Christi, Texas to Detention:

Unit: Sector Corpus Christi

Prive Shipping Denizcilik Ticaret A.S.

SLH2021 S. A.

Charterers

Ship Management: Owners, Operators, or Managers

Petro Plus General Trading LLC

Deficiencies: Code - Category Description

> 15105 - Resources and personnel Objective evidence discovered in an expanded ISM examination revealed the vessel failed to fully implement the requirements of the ISM Code through their SMS

procedures as evident by deficiencies 02, 03, and 04. This indicates that the ship and/or company are not meeting the SMS requirements. An external audit is required.

04109 - Fire drills The drills of the crew shall take place within 24 h of the

> ship leaving port if more than 25% of the crew have not participated in abandon ship and fire drills on board that particular ship in the previous month. When a ship enters service for the first time, after modifications of a major character or when a new crew is engaged, these drills shall be held before sailing. The drills required

Parties responsible for fire extinguishing shall be

were not held before sailing when a new crew was engaged, nor at any time during the following voyage.

performance (fire drills) organized. These parties shall have the capability to complete their duties at all times while the ship is in service. The vessel's crew lacked familiarity with shipboard fire extinguishing procedures and equipment. **During the fire drill, Port State Control Officers** observed a breakdown in communication resulting in a

with required equipment.

07110 - Fire fighting equipment and

07125 - Evaluation of crew

appliances

Crew members shall be trained to be familiar with the arrangements of the ship as well as the location and operation of any fire-fighting systems and appliances that they may be called upon to use. When requested by the PSCO to perform a routine test of the deck foam monitors, the crew was unable to operate the system for 20 minutes due to unfamiliarity with the piping and valve configuration.

loss of situational awareness, and a lack of familiarity