

Ship Name: **MSC MAUREEN**

Ship Type: **Containership**

Flag: **Panama**

IMO Number: **9251717**

Date of Action: **3/28/2026**

Action Taken: **Detention**

Port: **Staten Island, New York**

Unit: **Sector New York**

Recognized Org: **DNV**

Recognized Security
Organization (RSO):

Recognized Org
(RO) Related: **Not Class Related**

Relevant Certificates:

Organization Related
to Detention:

Ship Management: Owners, Operators, or Managers

Mediterranean Shipping Co Srl

COMPANIA NAVIERA DUART S.A.

Deficiencies: Code - Category

15109 - Maintenance of the ship and equipment

Description

The company should establish procedures to ensure that the ship is maintained in accordance with the provisions of the relevant rules and regulations established by the company. The technical and/or operational nature of deficiencies 02, 03, 04 and 05 provide objective evidence of a serious failure, or lack of effectiveness, of the implementation of the ISM Code. A safety management audit carried out by the Administration or the RO, with a corresponding report of findings satisfactory to the OCMI must be submitted prior to clearance of this deficiency and release from detention.

07126 - Oil accumulation in engine room

Means shall be provided to control leaks of flammable liquids. PSCO observed tape around source of leak that was failing and actively flowing into a full bucket of oil. Upon identification crew added more tape and painted tape silver. Leak continued to be active in the presence of examiners after more tape/paint was applied.

07199 - Other (fire safety)

Means of control for flammable liquids in the space shall be provided. PSCO observed improper stowage of various flammable materials inside a void.

07106 - Fire detection and alarm system

Maintenance, testing, and inspections shall be carried out based on the guidelines developed by the Organization and in a manner having due regard to ensuring the reliability of fire-fighting systems and appliances. PSCO observed flame detectors unable to activate properly per manufacturer's instructions. Crew then utilized an open flame to test flame detectors.

07126 - Oil accumulation in engine room

Means shall be provided to control leaks of flammable liquids. PSCO observed feed pump for HFO purifier slowly leaking oil,

